

[Federal Register: June 24, 2005 (Volume 70, Number 121)]
[Rules and Regulations]
[Page 36480-36482]
From the Federal Register Online via GPO Access [wais.access.gpo.gov]
[DOCID:fr24jn05-7]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2005-21624; Directorate Identifier 2005-NE-17-AD; Amendment 39-14162; AD 2005-13-25]

RIN 2120-AA64

Airworthiness Directives; Turbomeca S.A. Arriel 2B Turboshaft Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for Turbomeca S.A. Arriel 2B turboshaft engines with Modification TU62A incorporated. This AD results from several reports of the hydromechanical unit (HMU) acceleration controller axle sticking. This AD requires initial and repetitive inspections, cleaning, lubrication, and checks for proper operation of the HMU acceleration controller axle. We are issuing this AD to prevent loss of control of engine fuel flow in manual control mode or mixed control mode, leading to engine overspeed and in-flight engine shutdown, or uncommanded in-flight engine shutdown.

DATES: Effective July 11, 2005. The Director of the Federal Register approved the incorporation by reference of certain publications listed in the regulations as of July 11, 2005.

We must receive any comments on this AD by August 23, 2005.

ADDRESSES: Use one of the following addresses to comment on this AD:

- DOT Docket Web site: Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.
- Government-wide rulemaking Web site: Go to <http://www.regulations.gov> and follow the instructions for sending your comments electronically.
- Mail: Docket Management Facility; U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001.
- Fax: (202) 493-2251.
- Hand Delivery: Room PL-401 on the plaza level of the Nassif Building, 400 Seventh Street, SW., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Contact Turbomeca S.A., 40220 Tarnos, France; telephone 33 05 59 74 40 00, fax 33 05 59 74 45 15, for the service information identified in this AD.

FOR FURTHER INFORMATION CONTACT: Christopher Spinney, Aerospace Engineer, Engine Certification Office, FAA, Engine and Propeller Directorate, 12 New England Executive Park, Burlington, MA 01803-5299; telephone (781) 238-7175; fax (781) 238-7199.

SUPPLEMENTARY INFORMATION: The Direction Generale de L'Aviation Civile (DGAC), which is the airworthiness authority for France, notified us that an unsafe condition might exist on Turbomeca S.A. Arriel 2B turboshaft engines with Modification TU62A incorporated. The DGAC advises that several reports of the HMU acceleration controller axle sticking have been received that resulted in engine overspeed and in-flight engine shutdown, or uncommanded in-flight engine shutdown. These events can occur when the fuel system is either in manual control mode or mixed control mode. They are most likely to occur during an HMU failure simulation or during autorotation training. HMU acceleration controller axle sticking can result in an excessive decrease in engine speed when the manual control is used to reduce fuel flow. It can also result in an excessive increase in engine speed when moving the control back to the flight notch. We are issuing this AD to prevent loss of control of engine fuel flow in the manual control mode or mixed control mode, leading to engine overspeed and in-flight engine shutdown, or uncommanded in-flight engine shutdown.

Relevant Service Information

We have reviewed and approved the technical contents of Turbomeca Alert Mandatory Service Bulletin (ASB) No. A292 73 2814, Update No. 1, dated January 11, 2005. That ASB describes procedures for inspecting, lubricating, and checking for proper operation of the HMU acceleration controller axle. The DGAC classified this service bulletin as mandatory and issued AD F-2004-139, dated August 18, 2004, in order to ensure the airworthiness of these Arriel 2B turboshaft engines in France.

Bilateral Airworthiness Agreement

This Turbomeca Arriel 2B turboshaft engine model is manufactured in France. It is type certificated for operation in the United States under the provisions of section 21.29 of the Federal Aviation Regulations (14 CFR 21.29) and the applicable bilateral airworthiness agreement. Under this bilateral airworthiness agreement, the DGAC has kept the FAA informed of the situation described above. We have examined the findings of the DGAC, reviewed all available information, and determined that AD action is necessary for products of this type design that are certificated for operation in the United States.

FAA's Determination and Requirements of This AD

The unsafe condition described previously is likely to exist or develop on other Turbomeca Arriel 2B turboshaft engines of the same type design. We are issuing this AD to prevent loss of control of engine fuel flow in the manual control mode or mixed control mode, leading to engine overspeed and in-flight engine shutdown, or uncommanded in-flight engine shutdown. This AD requires initial and repetitive inspections, cleaning, lubrication, and checks for proper operation of the HMU acceleration controller axle. You must use the service information described previously to perform the actions required by this AD.

Since an unsafe condition exists that requires the immediate adoption of this AD, we have found that notice and opportunity for public comment before issuing this AD are impracticable. We also found that good cause exists for making this amendment effective in less than 30 days.

Comments Invited

This AD is a final rule that involves requirements affecting flight safety and was not preceded by notice and an opportunity for public comment. However, we invite you to send us any written relevant data, views, or arguments regarding this AD. Send your comments to an address listed under ADDRESSES. Include "AD Docket No. FAA-2005-21624; Directorate Identifier 2005-NE-17-AD" in the subject line of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of the rule that might suggest a need to modify it.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact with FAA personnel concerning this AD. Using the search function of the DMS Web site, anyone can find and read the comments in any of our dockets. The Web site includes the name of the individual who sent the comment (or signed the comment on behalf of an association, business, labor union, etc.). You may review the DOT's complete Privacy Act Statement in the Federal Register published on April 11, 2000 (65 FR 19477-78) or you may visit <http://dms.dot.gov>.

Examining the AD Docket

You may examine the docket that contains the AD, any comments received, and any final disposition in person at the DMS Docket Offices between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Office (telephone (800) 647-5227) is located on the plaza level of the Department of Transportation Nassif Building at the street address stated in ADDRESSES. Comments will be available in the AD docket shortly after the DMS receives them.

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a summary of the costs to comply with this AD and placed it in the AD Docket. You may get a copy of this summary by sending a request to us at the address listed under ADDRESSES.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Under the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

AIRWORTHINESS DIRECTIVE



Aircraft Certification Service
Washington, DC

U.S. Department
of Transportation
**Federal Aviation
Administration**

We post ADs on the internet at "www.faa.gov"

The following Airworthiness Directive issued by the Federal Aviation Administration in accordance with the provisions of Title 14 of the Code of Federal Regulations (14 CFR) part 39, applies to an aircraft model of which our records indicate you may be the registered owner. Airworthiness Directives affect aviation safety and are regulations which require immediate attention. You are cautioned that no person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of the Airworthiness Directive (reference 14 CFR part 39, subpart 39.3).

2005-13-25 Turbomeca S.A.: Amendment 39-14162. Docket No. FAA-2005-21624; Directorate Identifier 2005-NE-17-AD.

Effective Date

- (a) This airworthiness directive (AD) becomes effective July 11, 2005.

Affected ADs

- (b) None.

Applicability

- (c) This AD applies to Turbomeca S.A. Arriel 2B turboshaft engines with Modification TU62A incorporated. These engines are installed on, but not limited to, Eurocopter AS350B3 helicopters.

Unsafe Condition

- (d) This AD results from several reports of the hydromechanical unit (HMU) acceleration controller axle sticking. We are issuing this AD to prevent loss of control of engine fuel flow in the manual control mode or mixed control mode, leading to engine overspeed and in-flight engine shutdown, or uncommanded in-flight engine shutdown.

Compliance

- (e) You are responsible for having the actions required by this AD performed within the compliance times specified unless the actions have already been done.
- (f) Within 20 operating hours after the effective date of this AD, inspect, clean, lubricate, and check for proper operation of the HMU acceleration controller axle. Use paragraph 2 of Instructions to be Incorporated of Turbomeca Alert Mandatory Service Bulletin No. A292 73 2814, Update No. 1, dated January 11, 2005, to do these actions.
- (g) Thereafter, repeat the actions specified in paragraph (f) of this AD within every 210 operating hours.

Alternative Methods of Compliance

(h) The Manager, Engine Certification Office, has the authority to approve alternative methods of compliance for this AD if requested using the procedures found in 14 CFR 39.19.

Related Information

(i) DGAC airworthiness directive F-2004-139, dated August 18, 2004, also addresses the subject of this AD.

Material Incorporated by Reference

(j) You must use Turbomeca Alert Mandatory Service Bulletin (ASB) No. A292 73 2814, Update No. 1, dated January 11, 2005, to perform the actions required by this AD. The Director of the Federal Register approved the incorporation by reference of this service bulletin in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. Contact Turbomeca S.A., 40220 Tarnos, France; telephone 33 05 59 74 40 00, fax 33 05 59 74 45 15, for a copy of this service information. You may review copies at the Docket Management Facility; U.S. Department of Transportation, 400 Seventh Street, SW., Nassif Building, Room PL-401, Washington, DC 20590-0001, on the internet at <http://dms.dot.gov>; or at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, call 202-741-6030, or go to: http://www.archives.gov/federal_register/code_of_federal_regulations/ibr_locations.html.

Issued in Burlington, Massachusetts, on June 16, 2005.

Jay J. Pardee,

Manager, Engine and Propeller Directorate, Aircraft Certification Service.

[FR Doc. 05-12415 Filed 6-23-05; 8:45 am]

BILLING CODE 4910-13-P